SKETCH 7A	SLIP RISER FOR INSTALLATION ON SINGLE PHASE UNDERGROUND SERVICES	SKETCH 7A
SHEET 1 of 1		SHEET 1 of 1

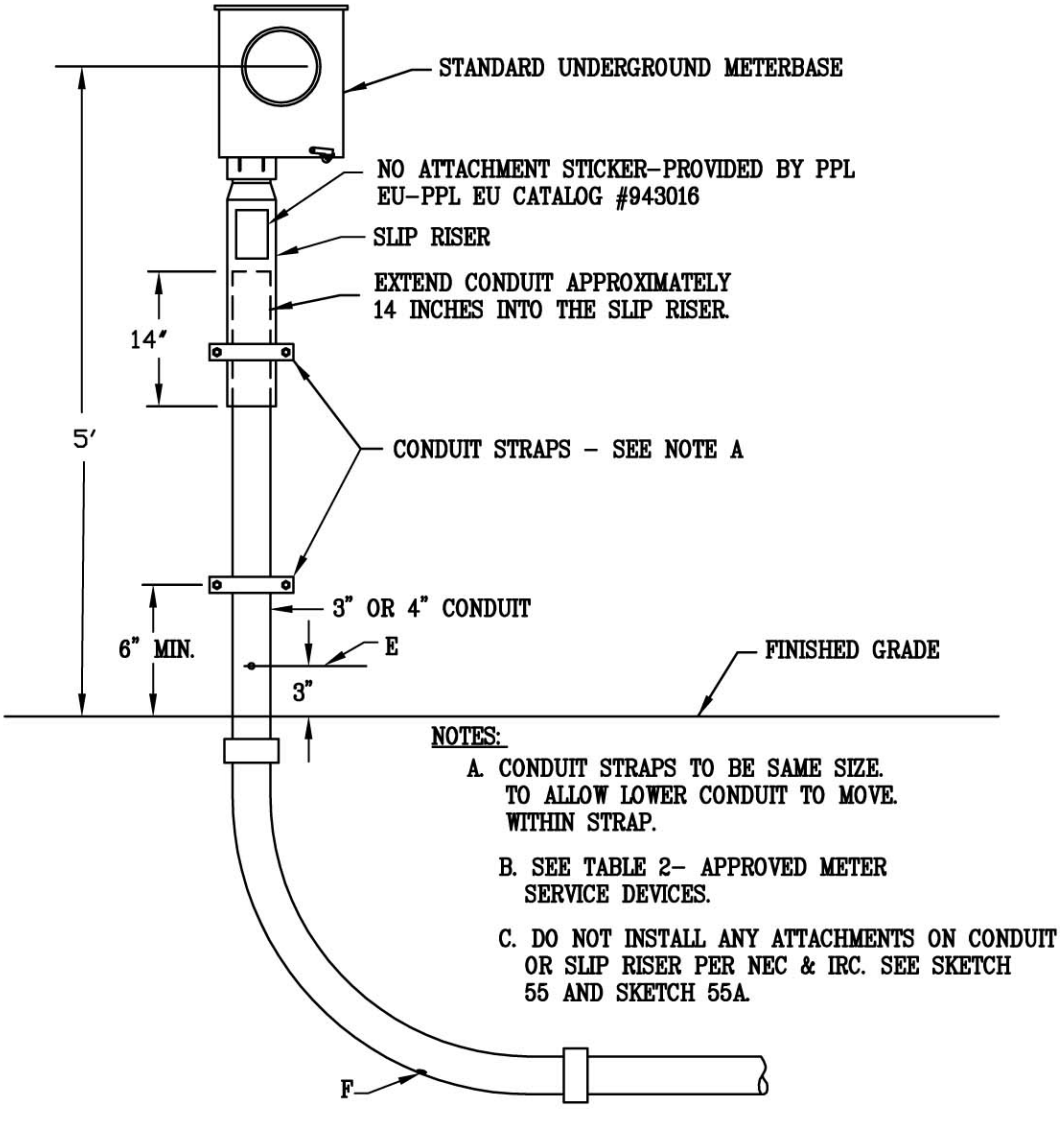

NOTES:

A. CONDUIT STRAPS TO BE SAME SIZE. TO ALLOW LOWER CONDUIT TO MOVE. WITHIN STRAP.

B. SEE TABLE 2– APPROVED METER SERVICE DEVICES.

C. DO NOT INSTALL ANY ATTACHMENTS ON CONDUIT OR SLIP RISER PER NEC & IRC. SEE SKETCH 55 AND SKETCH 55A.

D. 50" MINIMUM CLEAR SPACE IN FRONT OF METER BASE. SEE RULE 13, SKETCH 55 AND SKETCH 55A (SIDE VIEW).

E. DRILL 2–1/4" HOLES IN BACK OF CONDUIT 3" ABOVE GROUND PRIOR TO PULLING CABLE.

F. DRILL 2–1/4" HOLES IN BOTTOMSIDE OF ELBOW PRIOR TO PULLING CABLE.

G. SEE APPROVED SLIP RISER TABLE.

REFERENCE: CRS 6–19–133, CRS 6–19–134, SKETCH 55 & SKETCH 55A

RULES FOR ELECTRIC METER AND SERVICE INSTALLATIONS **PPL ELECTRIC UTILITIES CORPORATION**	**Rules:** 5, 6, 10, 11B, 13, 14 **Date:** 12/5/08 **Engr:** MDB	REMSI_S007A.dwg